

## TECHNICAL CONDITIONS No. 012/2022-R&D

for delivery of the bearing 72-10 and using with rotor cup

**Description of the goods:** special double row bearing for rotor spinning in Open-end textile

machines

**Drawing No.:** 72-10-00-6280

Marking: 72-10, Kinex logo, MADE IN SLOVAKIA, character code – on the

surface of outer ring

QR code – on the face of shaft (rotor cup side)

**Resilent mounting type:** 83-18-2, 83-18-4, 83-18-5

Working temperature: Open-end textile machines must be placed in the conditioned

environment, where the temperature is between 18-32°C and

relative humidity is about 50-65%.

Maximum revolutions:1 90 000 min<sup>-1</sup> + 1 %

Position in machine: Horizontal

**Dynamic load rate:** 1310 N for one row

Static load rate: 380 N for one row

**Belt load:** Fr  $\leq$  18 N

Roror cup weight: max. 0,025kg

**Unbalance:** Residual specific unbalance of bearing with the rotor cup can be in

both balancing planes max.  $0.25~\mu m$ . The maximum permissible specific unbalance in the textile operation in both balancing planes

levels is 0,5 µm

FAX: 00421 41 555 64 57

Tel.: 00421 41 555 66 01

http://www.kinex.sk

Relubrication interval: 2000±100hrs (quantity of the oil ISOFLEX PDP 65 KLUBER

LUBRICATION is approximately 0,4cm3 for the whole bearing -

0,2cm<sup>3</sup> for each row)

**Corrosion protection:** Conservation in oil fog, in order to avoid corrosion it is protected until

it is opened for the first time, but not later than 24 months from the

OR OS Žilina

Odd. Sa, vl. č.: 10613/L

CRN: 35 962 623

VAT: SK2022083382

packaging date marked at the package



**Packing:** 40 pcs in PE bag and carton box

Warranty: a. 8000 operating hours worked in a period no longer than 3 years, with

acceptable interruptions of 8%. Bearings discarded for failure beyond

tolerable outage will replace for new ones free of charge.


**b.** bearings discarded for their failure to 500 operational hours will replace free of charge (These bearings shall not be included in failures under a. of


Warranty section)

**c.** Operation of the bearings in damaged flexible nest or in any other flexible

nest that is not produced by The Seller is inadmissible

## Scheme of bearing:

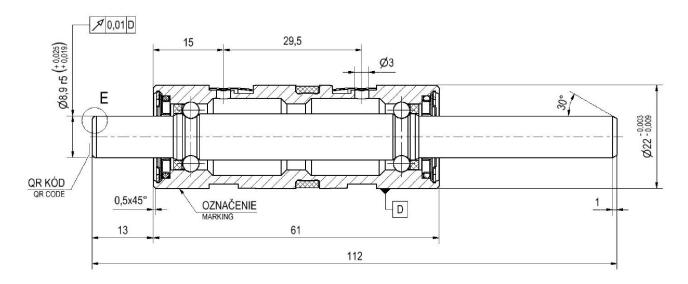

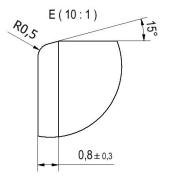

Bytča, February 23, 2022

FAX: 00421 41 555 64 57 Tel.: 00421 41 555 66 01 http://www.kinex.sk CRN: 35 962 623 VAT: SK2022083382 OR OS Žilina Odd. Sa, vl. č. : 10613/L