

TECHNICAL CONDITIONS No. 059/2022-R&D

for delivery of the bearing VALASKA 105 and using with rotor cup

Description of the goods: special double row bearing for rotor spinning in Open-end textile

machines

Drawing No.: 0-KB-TX-37-0091

Marking: VALASKA 105, Kinex logo, MADE IN SLOVAKIA, character code –

on the surface of outer ring

QR code – on the face of shaft (rotor cup side)

Resilent mounting type: 83-18-2, 83-18-4, 83-18-5

Working temperature: Open-end textile machines must be placed in the conditioned

environment, where the temperature is between 18-32°C and

relative humidity is about 50-65%.

Maximum revolutions: 105 000 min + 1 %

Position in machine: Horizontal

Dynamic load rate: 1310 N for one row

Static load rate: 380 N for one row

Belt load: Fr \leq 18N

Roror cup weight: max. 0,025kg

Unbalance: Residual specific unbalance of bearing with the rotor cup can be in

both balancing planes max. $0.25~\mu m$. The maximum permissible specific unbalance in the textile operation in both balancing planes

levels is 0,5 µm

Relubrication interval: 2000±100hrs (quantity of the oil ISOFLEX PDP 65 KLUBER

LUBRICATION is approximately 0,2cm³ for the whole bearing,

0,1cm³ for each hole)

Corrosion protection: Conservation in oil fog, in order to avoid corrosion it is protected until

it is opened for the first time, but not later than 24 months from the

packaging date marked at the package

FAX: 00421 41 555 64 57 Tel.: 00421 41 555 66 01 http://www.kinex.sk CRN: 35 962 623 VAT: SK2022083382 OR OS Žilina Odd. Sa, vl. č. : 10613/L





Packing: 40 pcs in PE bag and carton box

Warranty:

- **a.** 8000 operating hours worked in a period no longer than 3 years, with acceptable interruptions of 5%. Bearings discarded for failure beyond tolerable outage will replace for new ones free of charge.
- **b.** bearings discarded for their failure to 500 operational hours will replace free of charge (These bearings shall not be included in failures under a. of Warranty section)
- **c.** Operation of the bearings in damaged flexible nest or in any other flexible nest that is not produced by The Seller is inadmissible

Scheme of bearing:

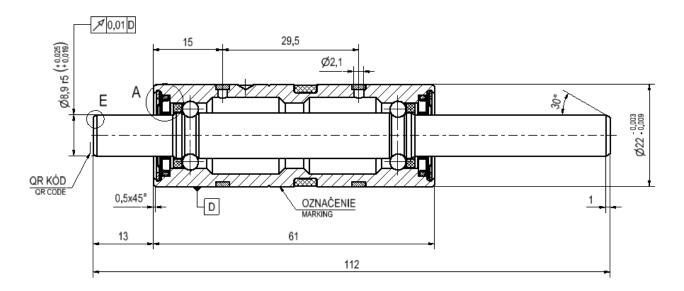

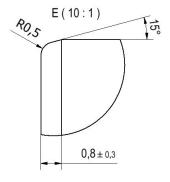

Bytča, October 30, 2023

FAX: 00421 41 555 64 57 Tel.: 00421 41 555 66 01 http://www.kinex.sk CRN: 35 962 623 VAT: SK2022083382 OR OS Žilina Odd. Sa, vl. č. : 10613/L